








## Metal Display Assembling

### Parts List

a: 1pc	b: 2pc	c: 4pcs	d: 1pc
			

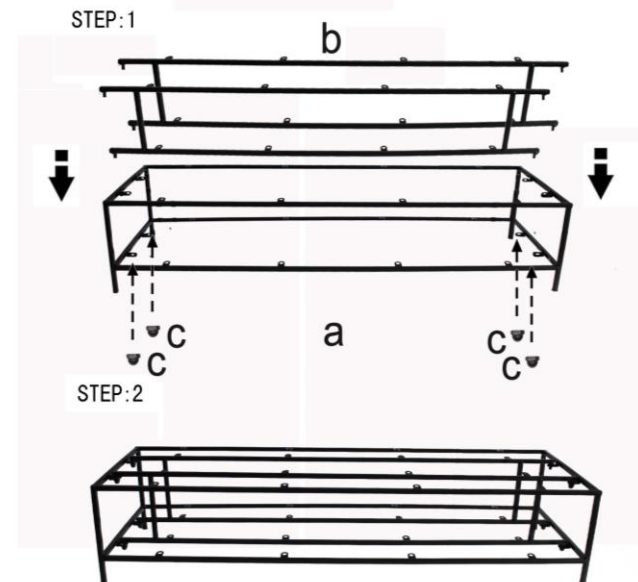

Step 1: Place the bottom (A) display on a leveled surface. Take both bars (B) and attach them to the holes found in the middle of the display, use 1 screw (C) per side tighten screws using the wrench (D). Make sure that all holes are on the same direction as shown in the diagram above.